


8608 Service Bulletin.

Steel hydraulic lines for cut off cylinders.

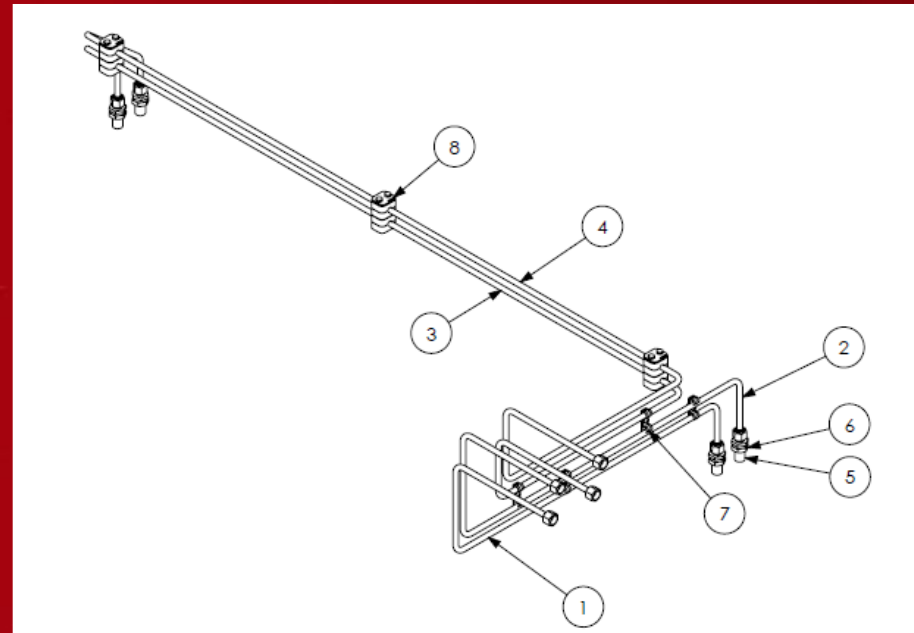

8/8/2024


Affected machines

All 8608 machines with a serial number between 401045 and 451290. When performing next maintenance should be inspected for steel line and replaced with hoses.

Please order 1 kit per unit # 1030184 thru parts .

Located inside the left side engine access door.

Steel lines behind the left and right cutoff cylinder valves.

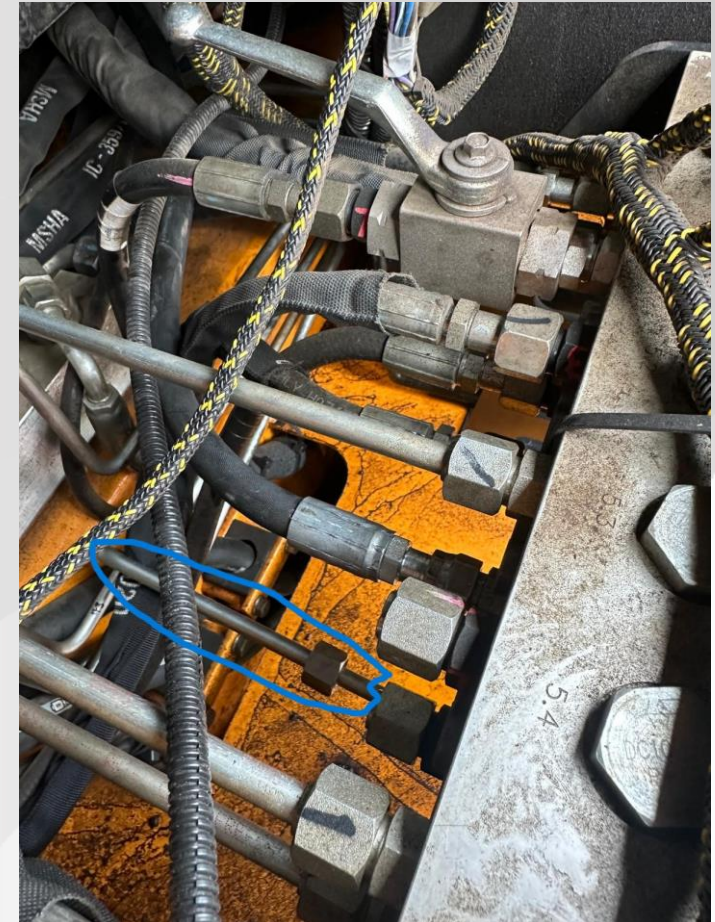


Inside the right and left engine access doors, Cutoff cylinder line bulkheads are located between tank and frame.

Use ratchet and a couple of extensions with a 21mm crow foot to remove the lines.


This will take 2 people to line the crow foot and Turn the nut to remove it.

Cut them, pull them out to discard.



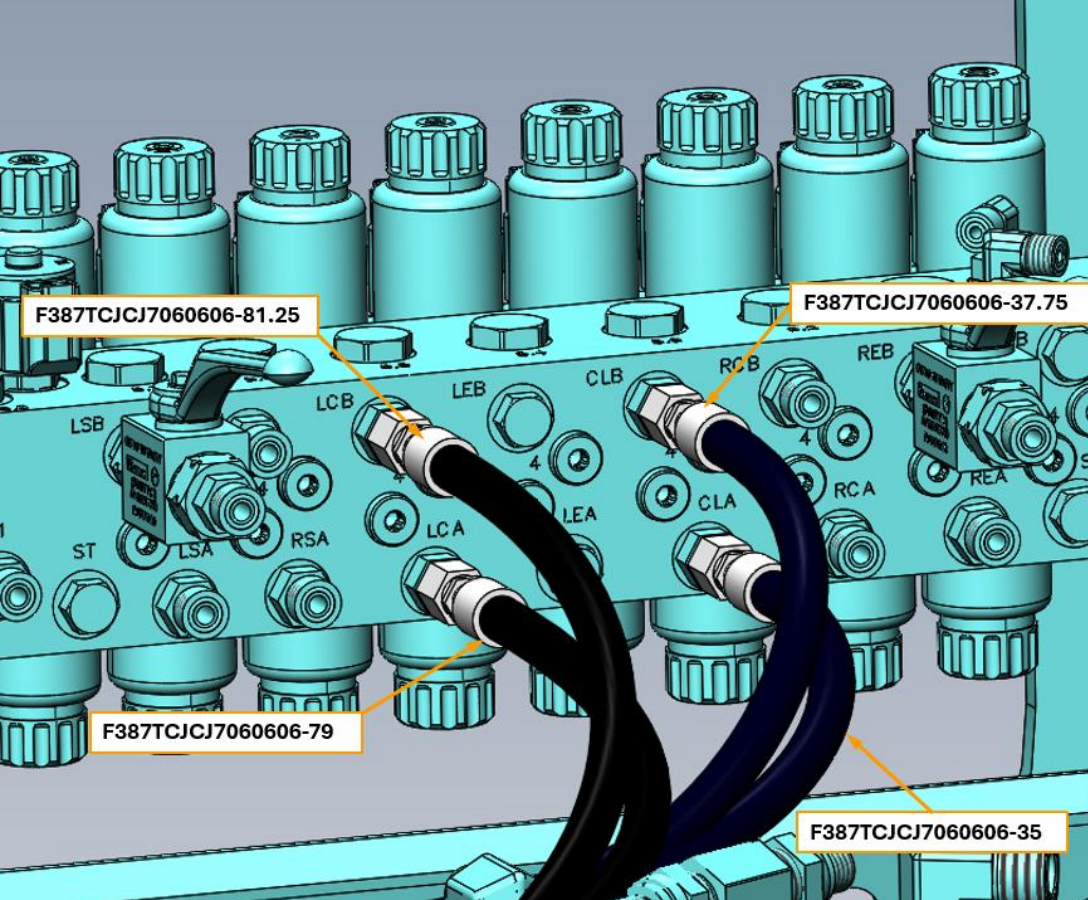


Hoses are identified. with part number and length.
The number after the dash is the length.

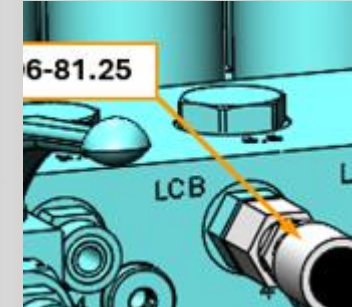


Hoses 85.25 and 79 both rout under the engine.

Hose 81.25 to LCB port


Hose 79 to LCA port

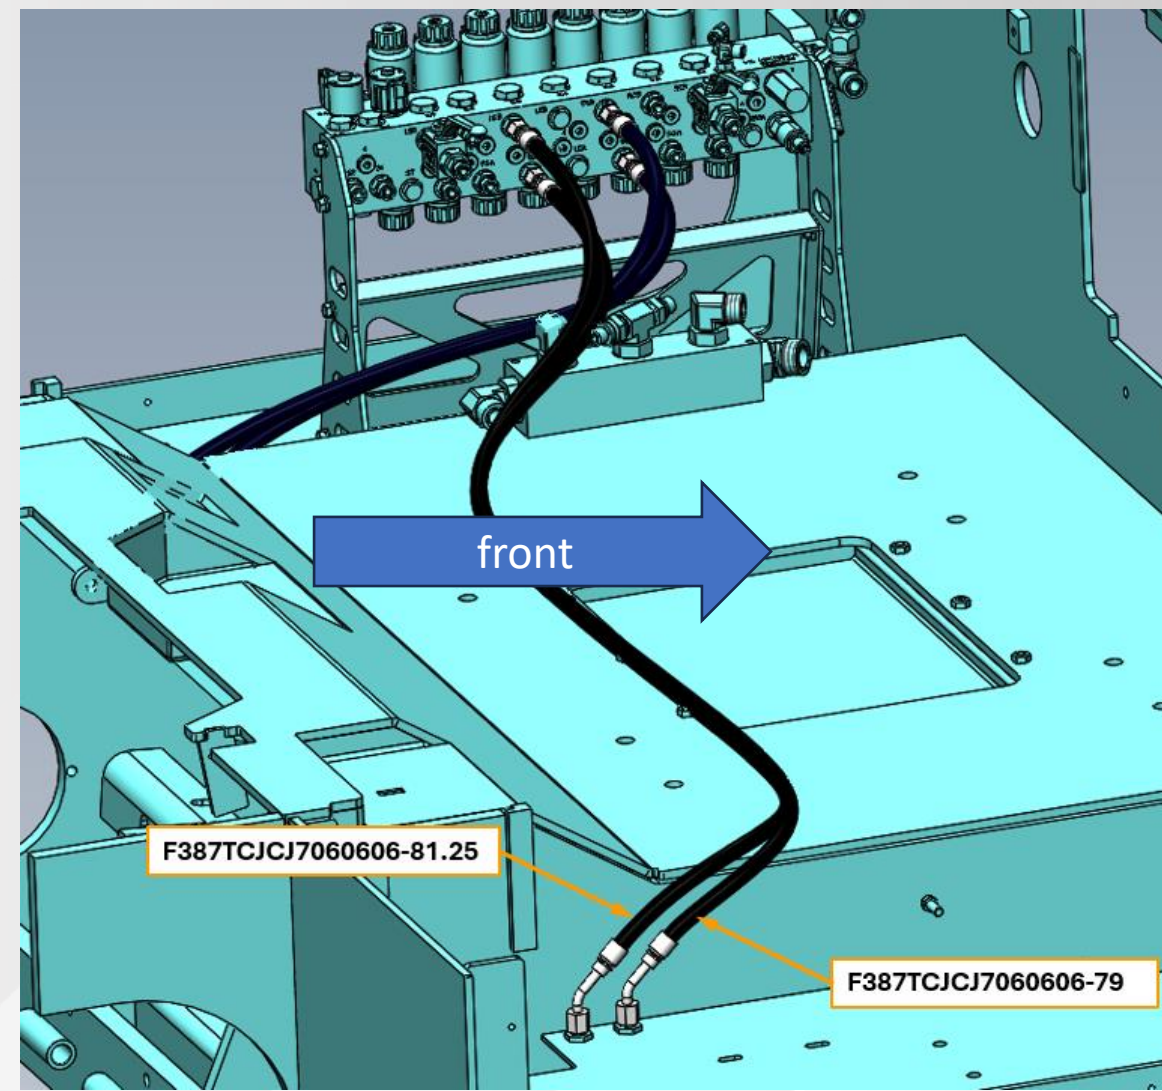

Hose 37.75 goes to port CLB

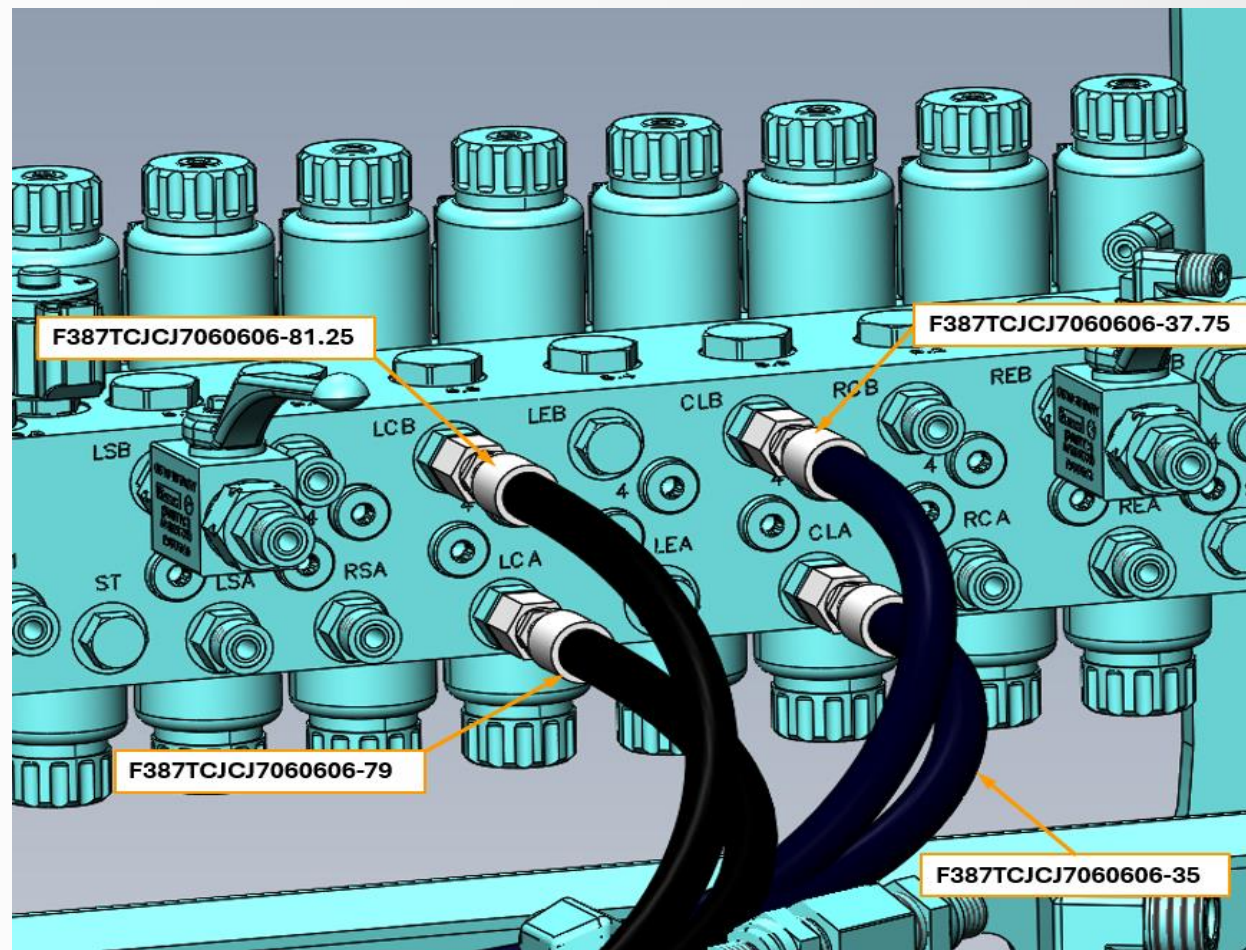

Hose 35 goes to port CLA

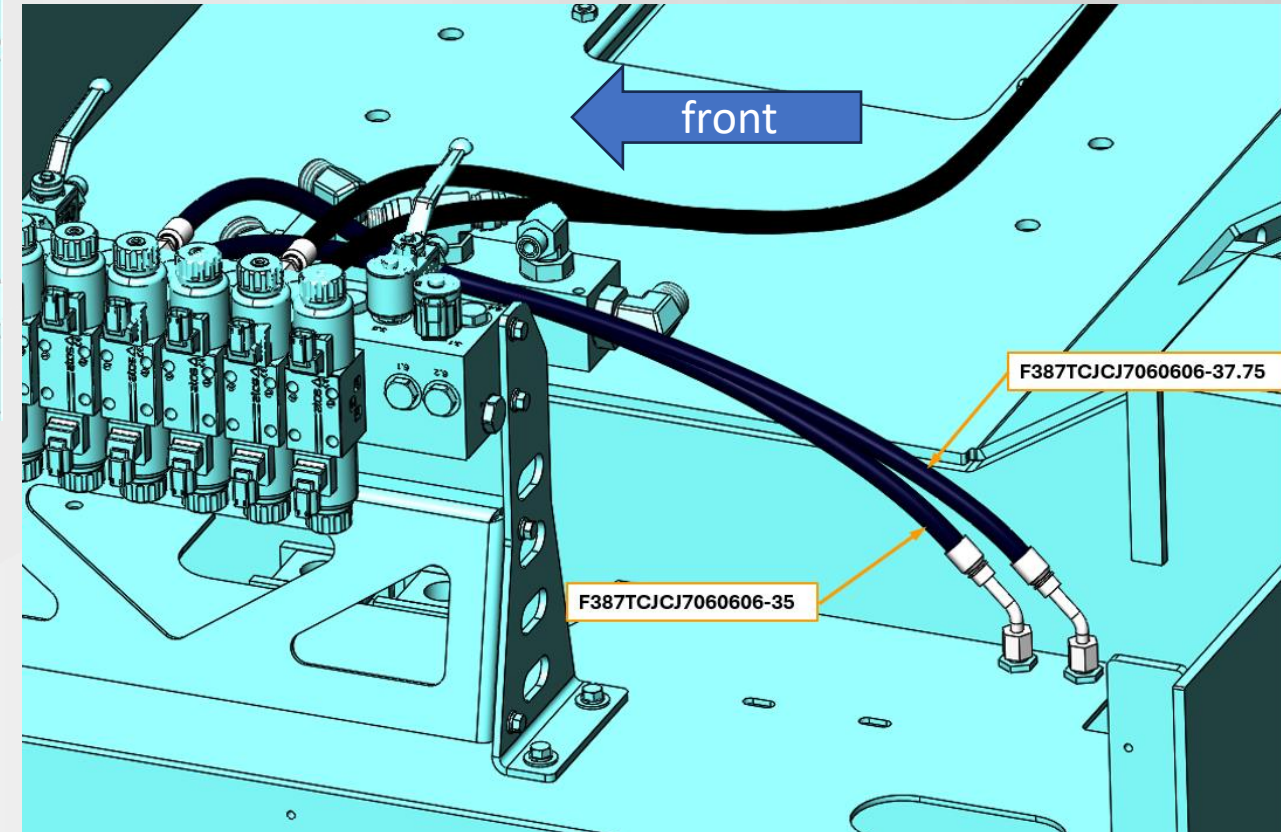



Leeboy will pay 5 hours for this repair.
Please file standard warranty.

For questions or concerns please call
rapid response 844 205 5499

Thank you